

Special Situations Call for Extraordinary Measures

By Lowell Pless – Business Development Mgr. - Distillation Applications, Pasadena, Texas USA

Tracerco is often challenged by a customer's plight: Can a gamma scan of a column over 25 ft. (7.5 m) in diameter or a column with a wall thickness greater than 2 inches (50 mm) generate results adequate to assist with diagnosing a problem? Will a gamma scan work on a liquid full column, like a liquid-liquid extractor? Typically when a column is greater than 25 ft. (7.5 m) diameter, has greater than a 2" (50 mm) wall thickness, or is liquid full Tracerco takes a slightly different approach to the scanning technique to produce the best results.

Tracerco's TRU-SCAN® or Tru-Grid™ Scan uses a small, gamma ray emitting radioisotope and a sensitive detector external to the column. The detector measures the intensity of radiation passing through the process equipment providing a profile of the relative density of the internal process which can be used to understand many aspects of the hydraulic operation of the equipment under investigation.

The following studies present examples of diagnostic results where a column's wall thickness or diameter exceeded the norm. It should be noted that due to safety reasons involved with the handling and transporting of radiation sources, there are practical limits to the size of equipment that can be successfully scanned.

Case 1. Base Liquid Level Detected In Tower with 7 inch (178 mm) Thick Walls

An 8 ft. (2.4 m) diameter and 7 inch (178 mm) wall thickness tower was experiencing high ΔP at increased rates and flooding or foaming was expected. Tracerco was contacted to

perform TRU-SCANS® to determine if flooding was occurring and to determine if any other problem was present. Due to the extreme wall thickness a source with higher energy was selected in combination with an ultrasensitive detector, built specifically and exclusively by Tracerco for challenging projects. Two scans were performed at different operating conditions. (Figure 1) The first scan (blue scanline) indicated all the trays (1 – 15) were in place, holding aerated material and were operating with what appeared to be heavy entrainment. Trays 1 – 9 indicated more froth/aeration density (higher degree of entrainment) between the trays compared to Trays 10 – 15. Furthermore, there was no indication of a bottoms level identified in the base of the tower, while control room instrumentation indicated a 50% base liquid level.

A second scan was performed (red scanline) at reduced vapor rates. Under these conditions there was a slight reduction in froth height on the trays and a decrease in entrainment between the tray decks. However, a base liquid level was detected approximately 14 – 16 inches below the top level tap, at a level of 70% (control room instrument indicated 100% level).

While the scans confirmed the tower was operating with high entrainment which could be the cause of the increased ΔP , a more significant finding was the results that indicated the base level instrumentation was not reading correctly.

Benefit

Presented with the challenge of a thick-walled vessel Tracerco successfully

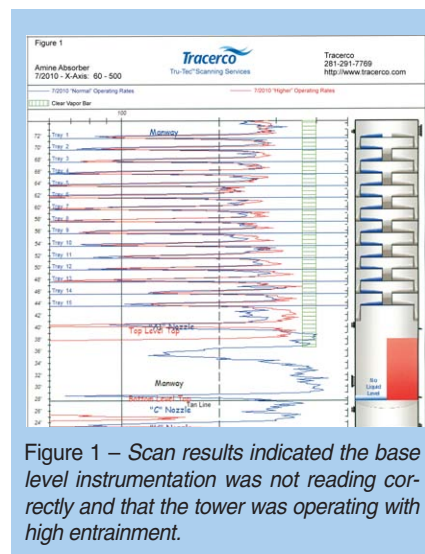


Figure 1 – Scan results indicated the base level instrumentation was not reading correctly and that the tower was operating with high entrainment.

planned and executed TRU-SCANS® using a high-energy source. The scans allowed diagnosis of the operating condition of this tower allowing the customer to avoid a needless shutdown and to learn of an associated operating problem regarding the liquid level.

Case 2. Tru-CAT™ Scans Detect Maldistribution In A 26 ft. Diameter Vacuum Tower

The top section of a Lube Vacuum tower at a North American refinery was not fractionating efficiently, lowering the yield and quality of the top side stream product. This efficiency loss was attributed to liquid mal-distribution likely from corrosion products plugging the gravity flow distributor above the packed bed. The customer had already discovered corrosion products plugging the distributor filter.

To quantify the location and magnitude of liquid mal-distribution, diagnostic

Continued on page 2

Gamma Scans

(Continued from page 1)

techniques including a Tracerco Tru-Grid™ Scan and Tru-CAT™ Scan were employed. The Tru-Grid™ Scan results indicated that the two beds were in place with characteristics of severe liquid mal-distribution (Figure 2). The top bed appeared to exhibit excessive liquid on the south side accompanied by liquid deficiency on the west side of the tower. Bed 2 appeared to be holding an excessive amount of liquid in the top section of packing and exhibited severe liquid mal-distribution. The liquid mal-distribution appeared to become less severe lower in the bed below the section of packing with excessive liquid accumulation. A close look at the collected data for the chimney tray between the beds indicated that liquid was overflowing the risers on the south and east scans. Liquid appeared to be level with the top of the risers on the north scan and

2 to 3 inches below the top of the risers on the west scan. The high liquid level was caused by reduced draw rate from the collector.

With the draw rate increased to prevent the collector from overflowing, a Tru-CAT™ Scan was performed at the elevation noted in Figure 2 in order to view in greater detail the pattern of liquid maldistribution.

The data in Figure 3 represents the Tru-CAT™ Scan results performed on Bed 2 of packing located below the VGO Draw. Two relative dry spots were identified – one in the northeast quadrant and the second on the west side of the tower.

With knowledge of the liquid mal-distribution patterns refinery staff developed an extraordinary online fix. The fix involved a pump-back reflux circuit off the top pump-around that was designed and installed in four months.

Benefit

The Tru-CAT™ Scan was used to determine the

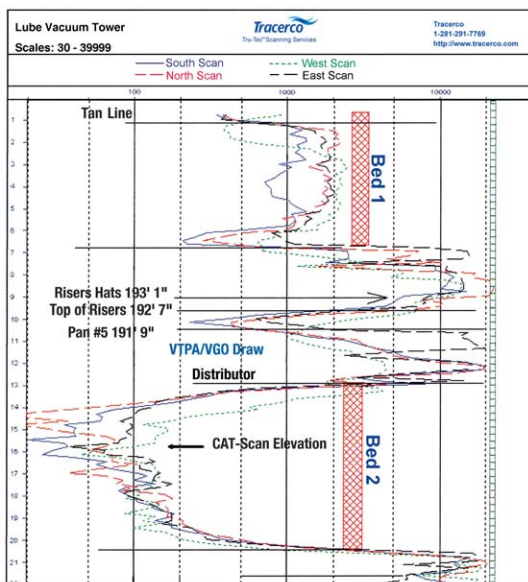


Figure 2 – Tru-Grid™ Scan data indicated that both beds were in place with characteristics of severe liquid maldistribution.

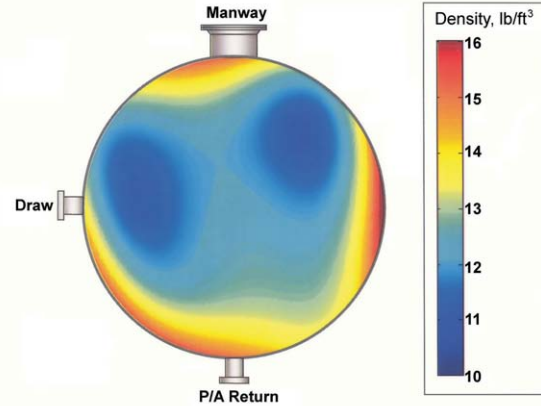


Figure 3 – Tru-CAT™ Scan color contour plot results illustrate where two dry spots were identified in a lube vacuum tower.

orientation of the new liquid distribution system focusing on the low liquid density areas of the tower cross-section. After start-up of the new circuit 65-70% of the lost top side stream yield was recovered with on specification product; exceeding expectations from the fix.

Case 3. Liquid-Liquid Extractor Applications

One category of special applications is liquid-liquid extractors. Besides the fact that liquid-liquid extractors are not “typical” distillation or fractionation unit operations, what makes them a special application for TRU-SCANS®? The radiation source and detector system that is used in scanning measures density changes of the process materials inside the tower. With a typical fractionation tower there is a large density difference between the vapor and liquid phases. Thus there is a large density range between clear vapor and clear liquid to detect process or operating conditions existing in a typical fractionation tower – entrainment, foaming, flooding, internal damage, etc. But liquid-liquid extractors are liquid full, with no large vapor-liquid density difference.

Meaningful scan results from a liquid-liquid tower rely on the density difference between the two liquid phases being significant enough to distinguish as some extraction processes involve two liquids that have comparable densities.

So what will a Tracerco TRU-SCAN® of a liquid-liquid extractor tower show? Since we do not have the large vapor-liquid density difference to work with, the information learned from a scan of a liquid-liquid extractor is less extensive than for a “typical” fractionation tower but not any less important. As the following examples show, scans of liquid-liquid extractors can detect problems when the two liquid phases are not properly mixing, preventing the tower from doing its proper extraction operation.

Figure 4 shows a liquid-liquid absorber tower with trays where amine is the heavy liquid phase and LPG is the light liquid phase. This absorber was designed for the trays to hold a level of amine (heavy phase) on the trays and for the LPG (light phase) to bubble up through the amine. On the top trays of this absorber (Trays 1 – 6) there was a dense mass sitting on

Continued on page 3

Gamma Scans (Continued from page 2)

the tray decks. Trays 1 – 6 were holding approximately 10 inches (250 mm) of amine. The remainder of the tray spacing was filled with light density phase LPG.

In this particular absorber there was a relatively large density difference between the amine (sp. gr. 1.0 – 1.1) and the LPG (0.5 – 0.6). The scan profile of trays operating normally closely resembles what would be seen from a typical liquid-vapor fractionation tower. The big difference is in the magnitude of radiation passing through the column. Note the radiation (horizontal X-axis) scale, which was 1 – 800 in Figure 4. In a typical fractionation tower the maximum counts would be in the high 1,000's due to the much lower density of the vapor phase.

Note the change in the

scan profile at Tray 7. Tray 7 has a level of dense phase liquid measuring approximately 38 inches (965 mm), much higher than the trays above. In addition Trays 8, 9, and 10 did not appear to have any appreciable level of dense phase liquid. The scan results showed that the amine or heavy phase liquid cannot flow past Tray 7 most likely due to a restriction in the downcomer from Tray 7. Trays 8 – 10 actually were “starved” of amine so only the light phase liquid LPG was seen on these trays. The customer is now aware of the type of operating bottleneck they have and can formulate an action plan to remedy the situation.

Figure 5 shows the scan results from an extraction tower with packed beds. If the two liquid phases were well mixed then the scan profile would be nearly a straight line due to the process density being uniform throughout the

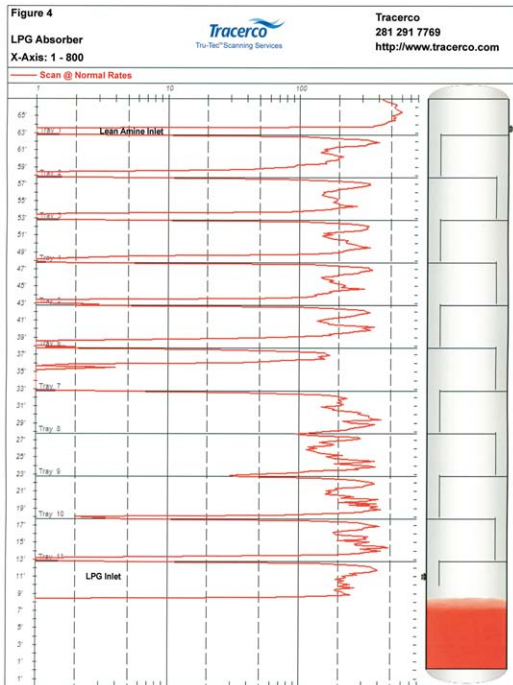


Figure 4 – Illustrates a scan plot of a trayed extraction tower where amine is the heavy liquid phase and LPG is the light liquid phase. A build-up of the heavy phase on Tray 7 showed a liquid restriction where the amine had trouble flowing past Tray 7.

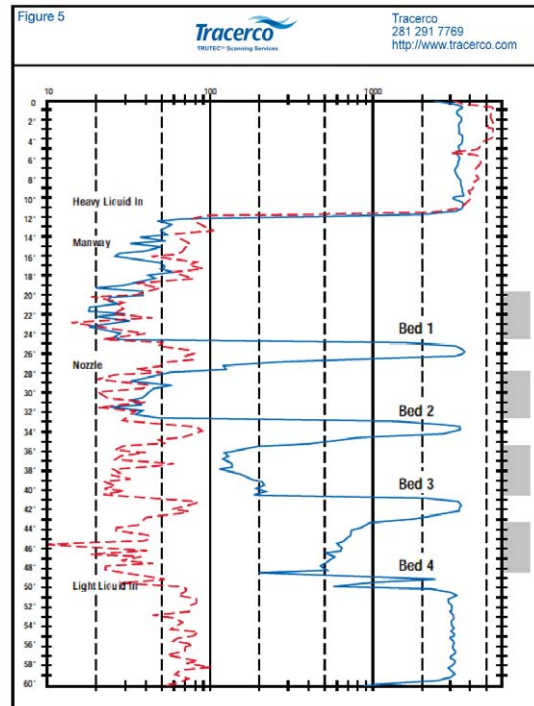


Figure 5 – An illustration showing the scan results from an extraction tower with packed beds. The blue-solid scanline illustrates scan results of the tower with operating problems. The red-dashed scanline indicates the process density being uniform throughout the tower.

tower. The red-dashed scanline curve in Figure 5 shows this. The blue-solid scanline shows what the extractor would look like when it had operating problems. First, pockets of lower density material were noticeable below each bed, showing that the light liquid phase was not able to flow through the packed beds. Second, Beds 3 and 4 were much lighter in density than Beds 1 and 2. Thus the tower was not well mixed but holding the light liquid phase in the bottom and keeping the heavy liquid phase in the top. This situation was due to the bottom of each bed of packing having a layer of fouling. The scan results showing good mixing were obtained after the extractor tower had been cleaned and returned to service (red-dashed scanline).

One indirect result from the scan when the tower operation was bad was being able to determine that the bed placement was correct.

Normally it would be very difficult to see where the beds are located from a scan when the extractor was in good operating condition due to all the liquid. However when the operation was bad, the pockets of light liquid trapped under each bed in the scan clearly identified where the beds were. It is ironic but a scan of a well operating liquid-liquid extractor usually reveals less information than a scan of an extractor with problems.

If you are considering scanning a tower with a large diameter, thick walls or a liquid-liquid extractor and you think that you might not receive adequate results please contact us to discuss your tower. There may be options to consider to help diagnose any problems present.

Empirical Data for Validation of Reactor Design

By Dave Ferguson, Business Development Manager – Tracer Applications, Pasadena, Texas USA

Even though formulas abound and experience is plentiful for successful reactor design there is still a degree of uncertainty present. Engineers and chemists program computers, wear out calculators, and scratch their heads until they often have to make an educated guess. However there are ways to gather empirical data to validate reactor design using tracer technology.

Steps to a Successful Reactor Design

The first step is to find all the published information available about the reaction that is going to occur, including temperature, pressure, pH of components and products, etc. From this information, some calculations and presumptions can be made as to the size, materials of construction, heat transfer to expect, etc.

The second step most projects go through is to build a pilot plant. In the pilot plant, various conditions can be trialed to determine the optimum conditions, degree of mixing, component ratios, etc.

The third step is to extrapolate the theory and the empirical data for scale-up of the pilot plant into a production unit.

The fourth step is to build and start up the production unit. Early in the life of the production reactor, the performance is measured and evaluated. Unfortunately, the performance is sometimes less than expected.

The fifth step of a successful reactor design, therefore, is to understand why it is not operating at optimal performance and plan modifications to improve performance.

Information Gathering

One of the most common questions asked about reactor performance at both the pilot plant and production stages is “What is the residence time and distribution of the components in the reactor?” With all the instrumentation that is available to monitor the reactor, this question is surprisingly difficult to answer. This question is followed by another, “What techniques are available that can be used to gather information about an on-line reactor so the design can be improved?”

The answer is that tracers can be used to gather this information. Radioactive tracer can often be injected and its movement and timing can be determined using external detectors. However, this technique does not work in every situation. In those cases, a radioactive or chemical tracer can be injected and samples can be collected from the outlet stream for analysis.

If the reactor is supposed to operate in some regime that is near plug flow, then a detector on the inlet and one on the outlet will produce responses similar to those shown in Figure 6. Using the Method of Moments analysis, the Mean Residence Time (MRT) and the Inverse Peclet Number can be calculated.

If the reactor is supposed to be operated in a reasonably well mixed regime, then an inlet and an outlet detector will produce responses similar to those shown in Figure 7 and the Method of Moments analysis can be used to calculate the MRT and the Stirred Tank Equivalent (STE).

First Case Study

One company operates a gas phase reactor with two

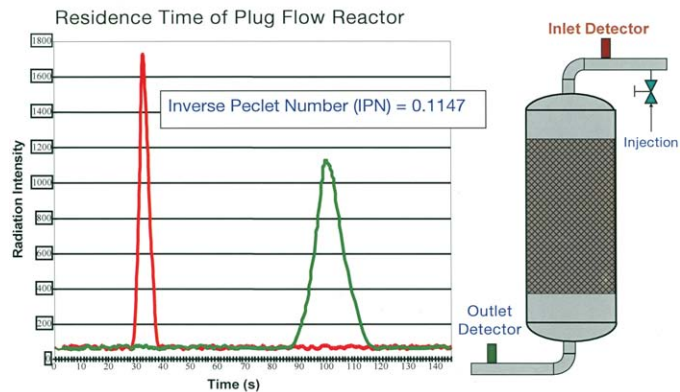


Figure 6 – Illustration of a reactor that is supposed to operate in some regime that is near plug flow. Detector placement on the inlet and one on the outlet will produce responses similar to the above illustration.

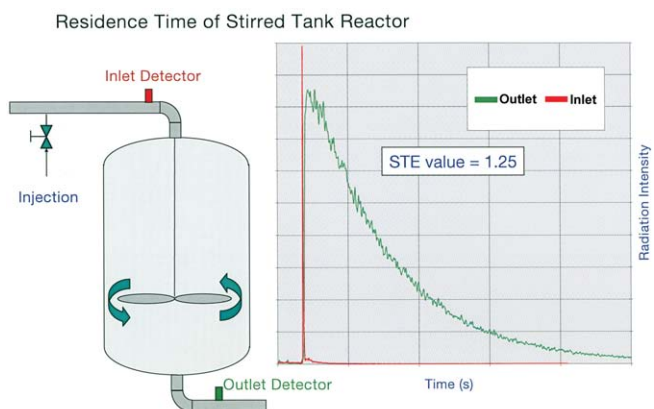


Figure 7 – Response data from a reactor operating in a reasonably well mixed regime with an inlet and outlet detector placement.

fixed catalyst beds. Upon startup, maldistribution was suspected to be the cause of lower than expected conversion. Four rings of six detectors were positioned at the elevations shown in Figure 8.

The first set of results (Figure 9) show the responses of the detectors in the top ring of the upper bed. It is obvious that the responses are not all of the same height or width. Using the Method of Moments analysis, the areas under each response curve were calculated. The areas under all six responses were summed and then each

area was divided by the summed area to calculate a percentage.

The radar plot in Figure 9 shows that almost 20 percent of the flow was measured near each of the NE and E detectors, about 17 percent at the NW and SE detectors, and 11 and 8 percent at the SW and W detectors respectively. Since each detector should have seen 16.7 percent, a total of 40 percent to the NE and E and only 20 percent to the SW and W, indicated serious maldistribution was present.

Continued on page 5

Reactor Design

(Continued from page 4)

The second graph (Figure 10) shows the results of the ring of detectors at the bottom of the lower bed. The detector responses were more similar to each other, but there was still a 58 to 42 percent flow bias to the east side of the reactor. The Mean Residence Time (MRT) was measured at 36.8 seconds from the upper bed top ring to the lower bed bottom ring and the overall MRT was 53.4 seconds.

The engineering staff operating this reactor took the opportunity at the next scheduled shutdown to change the inlet distributor and the redistributor between the beds. When the reactor was restarted, the performance improved.

Second Case Study

A North American plant that converts corn into ethanol for blending with gasoline wanted to determine the Mean Residence Time (MRT) of the fluid through one of their fermentation tanks. The tank was 100 ft. (30.5 m) in diameter and had a liquid depth of about 28 ft. (8.5 m), holding 1.6 million gallons (6.1 million liters) of water, corn, and sugar (Figure 11). One of the primary objectives was to determine if short circuiting of the feed was occurring.

Due to the size of the tank, this project would have taken an excessive amount of radioisotope tracer. Instead, 2200 lbs (1000 kg) of salt was dissolved in a 1000 gallon (3785 liters) portable tank with a mixer, the salt water was pumped into the fermentation tank, and then samples were taken of the tank effluent every 10 minutes for over 10

hours. The samples were sent to a nuclear research reactor for Neutron Activation Analysis. Each of the samples was briefly exposed to neutron radiation from the nuclear reactor which made the sodium atoms in the samples radioactive. The samples were then counted with a gamma spectrophotometer to determine the concentration of sodium in each sample.

The Method of Moments modelling for non-ideal flow was used for the calculation of the MRT and Stirred Tank

Continued on page 6

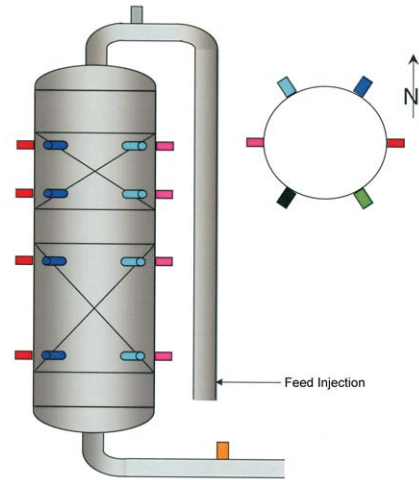


Figure 8 – Four rings of six detectors positioned at elevations show to produce results illustrated in Figures 9 and 10.

Top Ring of Upper Bed

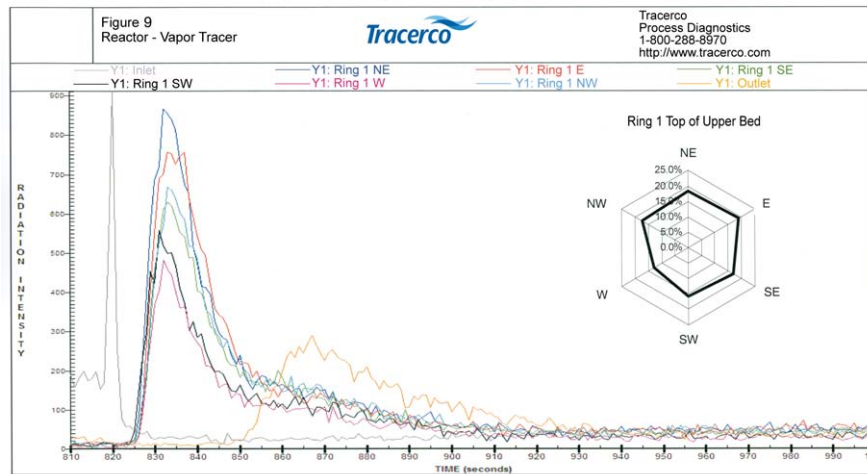


Figure 9 – The first set of results using the Method of Moments analysis indicated serious maldistribution was present.

Bottom Ring of Lower Bed

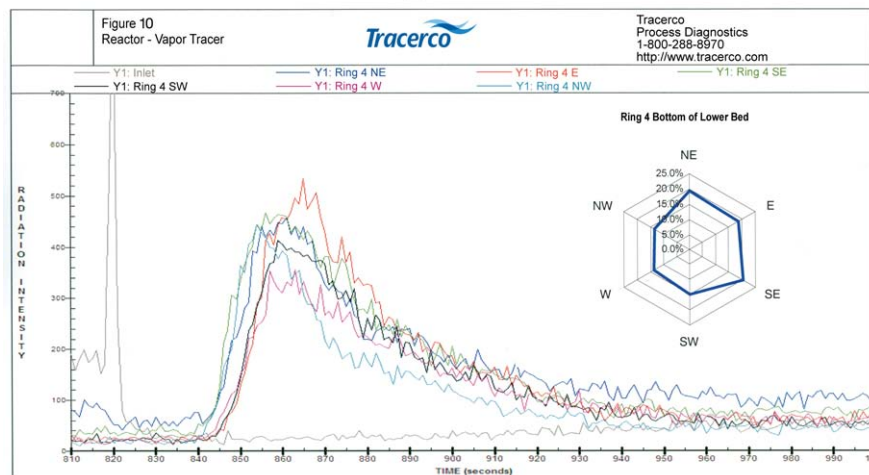


Figure 10 – Results of the ring of detectors at the bottom of the lower bed indicated there was still a 58 - 42% flow bias to the east side of the reactor.

Reactor Design

(Continued from page 5)

Equivalent (STE). Figure 12 shows the test results. An STE of 2.25 indicated that complete mixing would not occur unless there were at least three tanks. Short circuiting of the raw feed through the vessel had also been a concern, however the study found no evidence to support this.

Conclusion

Some aspects of reactor performance are difficult to measure. Tracer technology can be used in pilot plant and full scale facilities to gather critical information needed for optimal reactor design.

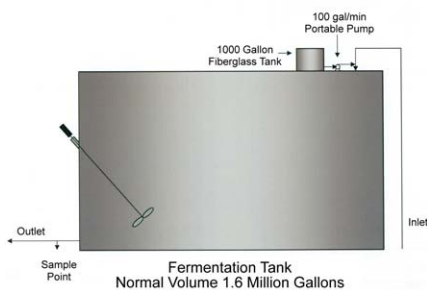


Figure 11 – A North American plant requested Tracerco to determine the Mean Residence Time (MRT) of fluid through one of their fermentation tanks. One of the primary objectives was to determine if short circuiting of the feed was occurring.

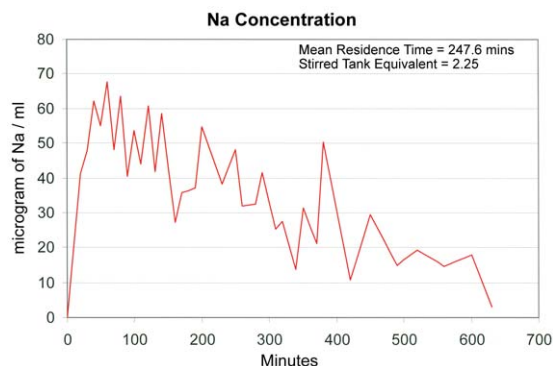


Figure 12 – The Method of Moments modelling for non-ideal flow was used for the calculation of the MRT and Stirred Tank Equivalent (STE).

Tracerco Distillation Forum Available

Tracerco is often contacted by experts that are consulting or working on large Distillation or FCCU projects to provide field data for troubleshooting and optimization. Tracerco uses this vast array of knowledge to feature case study articles at industry conferences, webinars, and on-site technical presentations for our customers. Our Team of Distillation, Heat Exchanger and FCC specialists have a huge amount of practical experience along with the hundreds of job case studies

to refer to for identifying process problems. This knowledge base provides our customers information of specific applications and techniques used worldwide to trouble-shoot and solve their process problems.

Tracerco's North American Distillation Applications Manger, Lowell Pless B.S. ChE, P.E., has conducted multiple distillation forums describing and providing examples of varied techniques useful for troubleshooting and diagnosing

hydraulic conditions within process equipment. Anyone who plays a role in process troubleshooting and optimization is welcome to contact Lowell at 281 291 7769 to discuss scheduling a technical forum for your plant-site.



North American Headquarters:
4106 New West Drive
Pasadena, TX 77507 USA
Tel: 281 291 7769
Fax: 281 291 7709
Toll Free: 800 288 8970

Field Office Locations:
Corpus Christi, TX 78408 USA
Tel: 361 888 8233

Concord, CA 94520 USA
Tel: 925 687 0900

Paramount, CA 90723 USA
Tel: 562 633 8800

Newark, DE 19702 USA
Tel: 302 454 1109

Merrillville, IN 46410 USA
Tel: 219 945 0400

Baton Rouge, LA 70820 USA
Tel: 225 761 0621

Salt Lake City, UT 84119 USA
Tel: 801 478 0736

Edmonton, AB, T6E 6A6 CANADA
Tel: 780 469 0055

Sarnia, ON, N7S 5G5 CANADA
Tel: 519 332 6160

Rio de Janeiro, RJ, Brasil, CEP 22775-044
Tel: +55 21 3535 7600



Please send me additional information on Tracerco's Specialist Measurement Instruments:

- The TRACERCO Profiler™
- TRACERCO™ Density gauge
- TRACERCO™ Level gauge
- TRACERCO™ Interface gauge
- TRACERCO™ PhaseGauge
- TRACERCO Diagnostics™ RapidScan
- The TRACERCO™ SmartGauge
- TRACERCO™ Level alarm
- TRACERCO™ Contamination monitor
- TRACERCO™ Radiation monitor

Name: _____

Job Title: _____

Company Name: _____

Address: _____

City: _____ State: _____ Zip Code: _____

Phone: _____ Email: _____

Vol 4 Ed 1

TRACERCO
4106 NEW WEST DRIVE
PASADENA TX 77507 USA

PLACE
STAMP
HERE



Would you like to learn about the most direct approach towards solving process problems while remaining on-stream. Tracerco offers an on-site technical presentation with case studies that can be mixed and matched to best suit your operational team.

If you would like to schedule an on-site presentation, please send in the attached card or contact a representative in your area.

- I would like to schedule an on-site lunch and learn presentation.
- Please email me a copy of your on-site presentation agenda.
- I would would not like to continue receiving future issues of Tracerco News.
- I would like to receive the newsletter by email. (please complete information below)

Email: _____

Name: _____

Job Title: _____ Phone: _____

Company Name: _____

Address: _____

City: _____ State: _____ Zip Code: _____

Vol 4 Ed 1

TRACERCO
4106 NEW WEST DRIVE
PASADENA TX 77507 USA

PLACE
STAMP
HERE

